

Work Order ID 115333

\*115333\*

Page 1

March-25-14 3:19:07 PM

Item ID: D407-667-205TRN

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Item Name: Crosstube Turning Detail

Stop \*NS2\*

Start Date: 3/25/14 Start Qty: 1.00 \*1\*

Cust Item ID:

Required Date: 4/08/14 Req'd Qty: 1.00 \*1\*

Customer:

Reference:

Approvals: Process Plan: ML5 Date: 14-03-25 Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start \*NR1\*

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
----------	--------------

D407-667-245	Rev F
--------------	-------

100

\*100\*

Mori Seiki

Mori Seiki CNC Lathe Large

MORI SEIKI CNC LATHE LARGE

Memo

1-Fill tube with sand & install plugs DT8531 on both ends as per Folio FA248

2-Turn first side as per Folio FA248

3-Blend transition lines only, \*\*do not sand whole tube\*\*:

FOLIO REV: AA

DWG REV: F

\*Use mill bastard file, brush file repeatedly with file card.

\*Do not use sandpaper coarser than 320 grit.

SCRAP

1  $\phi$  mm/LC  
14-03-26

110

\*110\*

QC

Quality Control

QC1- Inspect dimensions to dimension sheet

Memo

0.00

0.00

1  $\phi$  mm/LC

DQA:

Date: 14/01/25



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed:

Date: 14/4/15

Work Order update only ☐

Work Order: <u>115333</u>	<b>DISPOSITION</b>		<b>AGAINST DEPARTMENT/PROCESS</b>			
Part No. <u>D407-667-205TRA</u>	Rework <input type="checkbox"/>	Skid-tube <input type="checkbox"/>	Crosstube <input checked="" type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	
NCR No. <u>14-3148</u>	Scrap <input checked="" type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	
	Use-as-is <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	
	Suspected Unapproved <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>		

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design				Cuff dim is 2.451" and should be 2.420"	DAS 16 9-89	SCRAP UP 14/3/31			DAS 16 9-89
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

## FAULT CATEGORY

Landing Gear	General	
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Folio/Program
<input type="checkbox"/> Centre Not Concentric	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Grain
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damage/Defect	<input type="checkbox"/> Hardware
<input type="checkbox"/> Crimp/Kink/Ripple/Wave	<input type="checkbox"/> Burrs	<input type="checkbox"/> Inspection Incomplete/Unqualified
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Crushing	<input type="checkbox"/> Countersink	<input type="checkbox"/> Misaligned/off center
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Mislabeled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Drawing	<input type="checkbox"/> Misread
<input type="checkbox"/> Marks/Chatter	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Off-set
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Fit/Function	<input type="checkbox"/> Out of Sequence
		<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Set-up
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other

Work Order ID 115333

\*115333\*

Page 2

March-25-14 3:19:07 PM

Item ID: D407-667-205TRN

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Crosstube Turning Detail

Start Date: 3/25/14 Start Qty: 1.00 \*1\*

Cust Item ID:

Required Date: 4/08/14 Req'd Qty: 1.00 \*1\*

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start \*NR1\*

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120	MORI SEIKI CNC LATHE LARGE	0.00							
*120*									
Mori Seiki	Memo	0.00							
Mori Seiki CNC Lathe Large	1-Turn second side as per Folio FA248								
	2-Blend transition lines only, **do not sand whole tube**; *Use mill bastard file, brush file repeatedly with file card. *Do not use sandpaper coarser than 320 grit. FOLIO REV: _____ DWG REV: _____								
	3-Remove sand and plugs								
	4-Scribe part # and batch # using vibrating stylus as per Dwg D407-667-245								
130	QC1- Inspect dimensions to dimension sheet	0.00							
*130*									
QC	Memo	0.00							
Quality Control									

?  
Max

?  
Max

**Work Order ID 115333**

March-25-14 3:19:07 PM

**\*115333\***

Page 3

Item ID: D407-667-205TRN

Accept

**\*N900040100\***

Setup Start

**\*NS1\***

Revision ID:

Stop

**\*NS2\***

Item Name: Crosstube Turning Detail

Start Date: 3/25/14 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 4/08/14 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start

**\*NR1\***

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop

**\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140	QC8- Inspect parts - second check	0.00							
<b>*140*</b>									
QC	Memo	0.00							
Quality Control									
145		0.00							
<b>*145*</b>									
Crosstubes	Memo	0.00							
Crosstubes	Grind off circumferential machining marks longitudinally.								
150		0.00							
<b>*150*</b>									
HandFXtube	Memo	0.00							
Hand Finishing Crosstubes	1- PRESSURE WASH X-TUBE INSIDE AND OUT								
	2- ACID ETCH X-TUBE INSIDE AND OUT. USE RED SCOTCH BRITE								

Work Order ID 115333

March-25-14 3:19:07 PM

\*115333\*

Page 4

Item ID: D407-667-205TRN

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Item Name: Crosstube Turning Detail

Stop \*NS2\*

Start Date: 3/25/14 Start Qty: 1.00 \*1\*

Cust Item ID:

Required Date: 4/08/14 Req'd Qty: 1.00 \*1\*

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start \*NR1\*

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160	QC5- Inspect part completeness to step on W/O	0.00							
<b>*160*</b>									
QC	Memo	0.00							
Quality Control									
170		0.00							
<b>*170*</b>	Packaging								
Packaging	Memo	0.00							
Packaging	Identify and stock in kanban rackLocation: _____								
180	QC21- Final Inspection - Work Order Release	0.00							
<b>*180*</b>									
QC	Memo	0.00							
Quality Control									

14-03-31  
 Closed at  
 Scrapped

# Picklist Print

March-25-14 3:19:10 PM

Page 1

Work Order ID: 115333

**\*115333\***

Parent Item: D407-667-205TRN

**\*D407-667-205TRN\***

Parent Item Name: Crosstube Turning Detail

Start Date: 3/25/14

Required Date: 4/08/14

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A 08-03-06 new issue DD verified by:ec  
IPP Rev B 08.04.02 Removed polish EC verified by: DD  
IPP Rev:C 08-08-19 revE as per dwg DD verified by:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6011-115		Manufactured	No			120	Each	25.0000	1	1			

**\*D6011-115\***

Crosstube Material

**\*\***

Location

Loc Qty

Loc Code

LG003

25

67798

10

75639

15

KC 13-03-25


<b>DART AEROSPACE LTD</b>		<b>Work Order:</b>	<b>115333</b>
<b>Description:</b> Crosstube Assembly		<b>Part Number:</b>	<b>D407-667-245</b>
<b>Inspection Dwg:</b> D407-667-245 <b>Rev:</b> F		<b>Page 1 of 2</b>	

### FIRST ARTICLE INSPECTION CHECKLIST

Inspection Sheet Drawing Dimension		Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
<b>SIDE A</b>	2.490	+0.005/-0.000					
	1.832	+0.005/-0.000					
	1.838	+0.005/-0.000					
	1.892	+0.005/-0.000					
	2.052	+0.005/-0.000					
	2.206	+0.005/-0.000					
	2.521	+0.005/-0.000	2.524	/			
	2.633	+0.005/-0.000	2.635	/			
	4.10	+/-0.030					
	4.978	+/-0.030					
	2.040	+0.000/-0.010					
	0.125	+/-0.010					
	R0.063	+/-0.010					
	R0.500	+/-0.010					
	<b>SIDE B</b>	2.490	+0.005/-0.000	2.456		/	
1.832		+0.005/-0.000					
1.838		+0.005/-0.000					
1.892		+0.005/-0.000					
2.052		+0.005/-0.000					
2.206		+0.005/-0.000					
2.521		+0.005/-0.000	2.524	/			
2.633		+0.005/-0.000	2.635	/			
4.10		+/-0.030					
4.978		+/-0.030					
2.040		+0.000/-0.010	2.037	/			
0.125		+/-0.010					
R0.063		+/-0.010					
R0.500		+/-0.010					
112.91		+/-0.020	112.90	/		TAPE	LG-25

<b>DART AEROSPACE LTD</b>	<b>Work Order:</b>	115333
<b>Description:</b> Crosstube Assembly	<b>Part Number:</b>	D407-667-245
<b>Inspection Dwg:</b> D407-667-245 Rev: F		<b>Page 2 of 2</b>

### WALL THICKNESS MEASUREMENT

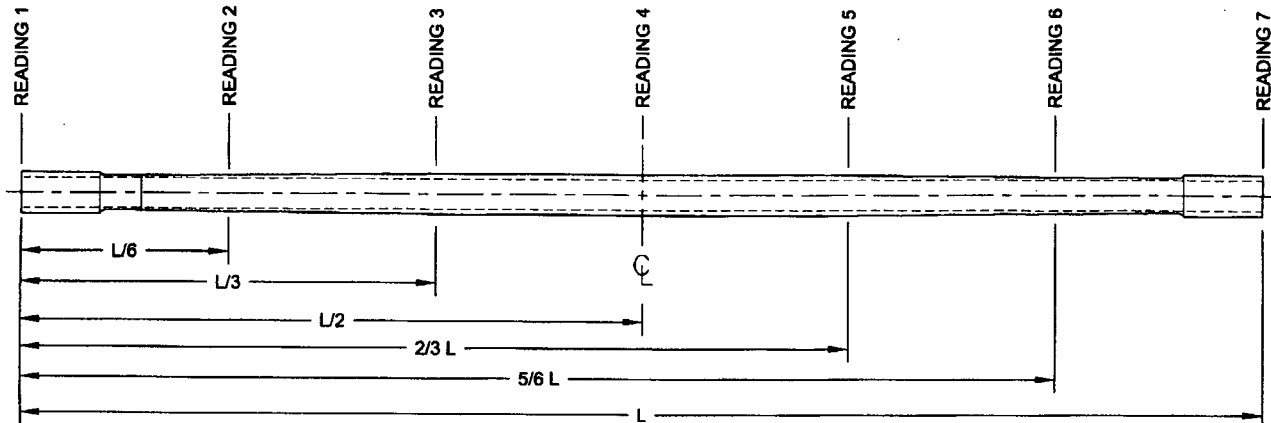

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation $\Delta w$ (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"						0.075"
READING 2 L=						
READING 3 L=						
READING 4 L=						
READING 5 L=						
READING 6 L=						
READING 7 L=						

#### Calibration Result

Actual Block Thickness: \_\_\_\_\_

Sitiescan 250 Measured Thickness: \_\_\_\_\_

<b>Measured by:</b>		<b>Audited by:</b>		<b>Preliminary Approval:</b>	
<b>Date:</b>		<b>Date:</b>		<b>Date:</b>	

Rev	Date	Change	Revised by	Approved
A	04.04.21	New Issue (P/O D407-667-205)	KJ/RF	
B	06.03.09	Dwg Rev updated	KJ/JLM	
C	06.03.30	Tolerance revised for 4.978 dimension	KJ/JLM	
D	07.02.19	Dwg Rev updated	KJ/JLM	
E	09.05.20	Dwg Rev updated	KJ	
F	12.06.04	Wall thickness form added	KJ	




Item	QTY -245	PART NUMBER	DESCRIPTION
1	X	D407-667-245	CROSSTUBE ASSEMBLY (407 HIGH AFT)
2	1	D6011-115	CROSSTUBE
3	2	D2856-400-773	ABRASION STRIP
4	2	D2873-043	NUT PLATE
5	2	D2873-045	NUT PLATE
6	1	D2894-1	SUPPORT
7	2	D3190-1	CHAFING SHIELD
8	2	D3595-063-430	RUBBER CUSHION
9	14	MS20601AD4W8	RIVET (OR NAS9302B-4-8)
10	4	MS21920-22	CLAMP
11	2	MS21920-25	CLAMP (OR MS21920-24)
12	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947- 100, TYPE II, CLASS 2 ADHESIVE)


# **GENERAL NOTES:**

- 1) MATERIAL: MANUFACTURED FROM D6011-115  
FINISHED LENGTH = 112.91±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D407-667-245" AND BATCH NUMBER ON  
INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 27.7 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 6 PASSES. MAXIMUM TUBE FLATTENING DUE TO  
BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2894-1 CENTER SUPPORT USING A 0.03" TO 0.06" THICK LAYER OF MAGNOBOND  
6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO  
PACKAGING.
- 13) INSTALL MS21920-25 CLAMPS WITH D3595-063-430 RUBBER CUSHIONS TO SECURE D2894-1  
SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE CROSSTUBE  
SUPPORT.  
**NOTE:** MS21920-24 CLAMPS CAN BE USED TO ACCOMMODATE VARYING DIAMETERS.  
ENSURE THERE IS A MINIMUM OF 1.5 THREADS IN SAFETY ON THE NUTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE  
OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS  
SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT  
LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) INSTALL D2856-400-773 ABRASION STRIP WITH A 0.13 (REF) GAP ON BOTTOM SIDE OF  
CROSSTUBE, PER QSI 035.
- 16) INSTALL D3190-1 CHAFING SHIELDS SO THAT OVERLAP IS ON BOTTOM SIDE OF CROSSTUBE  
OPPOSITE D2894-1 SUPPORT.
- 17) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN  
SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

115333 MCL  
1403-25  
@DEO ATTACHED  
**RELEASED**  
01/11/12 N/A

F	REFORMAT NOTES TO NEW STANDARDS (ZN B8-1); RELOCATED FLAG # 6 (ZN A8-3) PER NCR 210; REMOVED REF. & ADD TOLERANCES (ZN C6-3, C4-3 & D2-3)	RF	08.11.06
E	8.02 AND 8.53 WERE 8.40 AND 8.90 (ZN D5-2); REORGANIZED VIEWS AND REFORMATED DRAWING TO CURRENT STANDARDS. REASONS: CLAMPS MOVED 0.375 TOWARD CL TO ELIMINATE INTERFERENCE WITH AIRCRAFT MOUNTS. REFERENCE: PAR#08-21 AND ECN#1225	MB	08.07.24
D	ADD VIEW FOR OEM SKID HOLES, ROTATE ORIENTATION OF CLAMPS SECTION F-F, REMOVE -851 ABRASION STRIP, ADD MAGNOBOND 6398, ADD CUSHION	PH	07.02.07
C	ADD HOLES AND NUT PLATES FOR COMPATIBILITY WITH BHT/AA SKIDTUBES	PH	05.07.26
B	ADD CHAFING SHIELD	CP	03.05.21
A	NEW ISSUE	CP	02.05.13
REV.	DESCRIPTION	BY	DATE
DESIGN	40		
DRAWN	RF		
CHECKED	40		
MFG. APPR.	40		
APPROVED	40		
DE APPR.	40		
DATE	08.11.06		
<b>DART AEROSPACE LTD</b> HAWKESBURY, ONTARIO, CANADA DRAWING NO. D407-667-245 REV. F SHEET 1 OF 4 TITLE CROSSTUBE ASSY (407 HIGH AFT) SCALE NTS COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

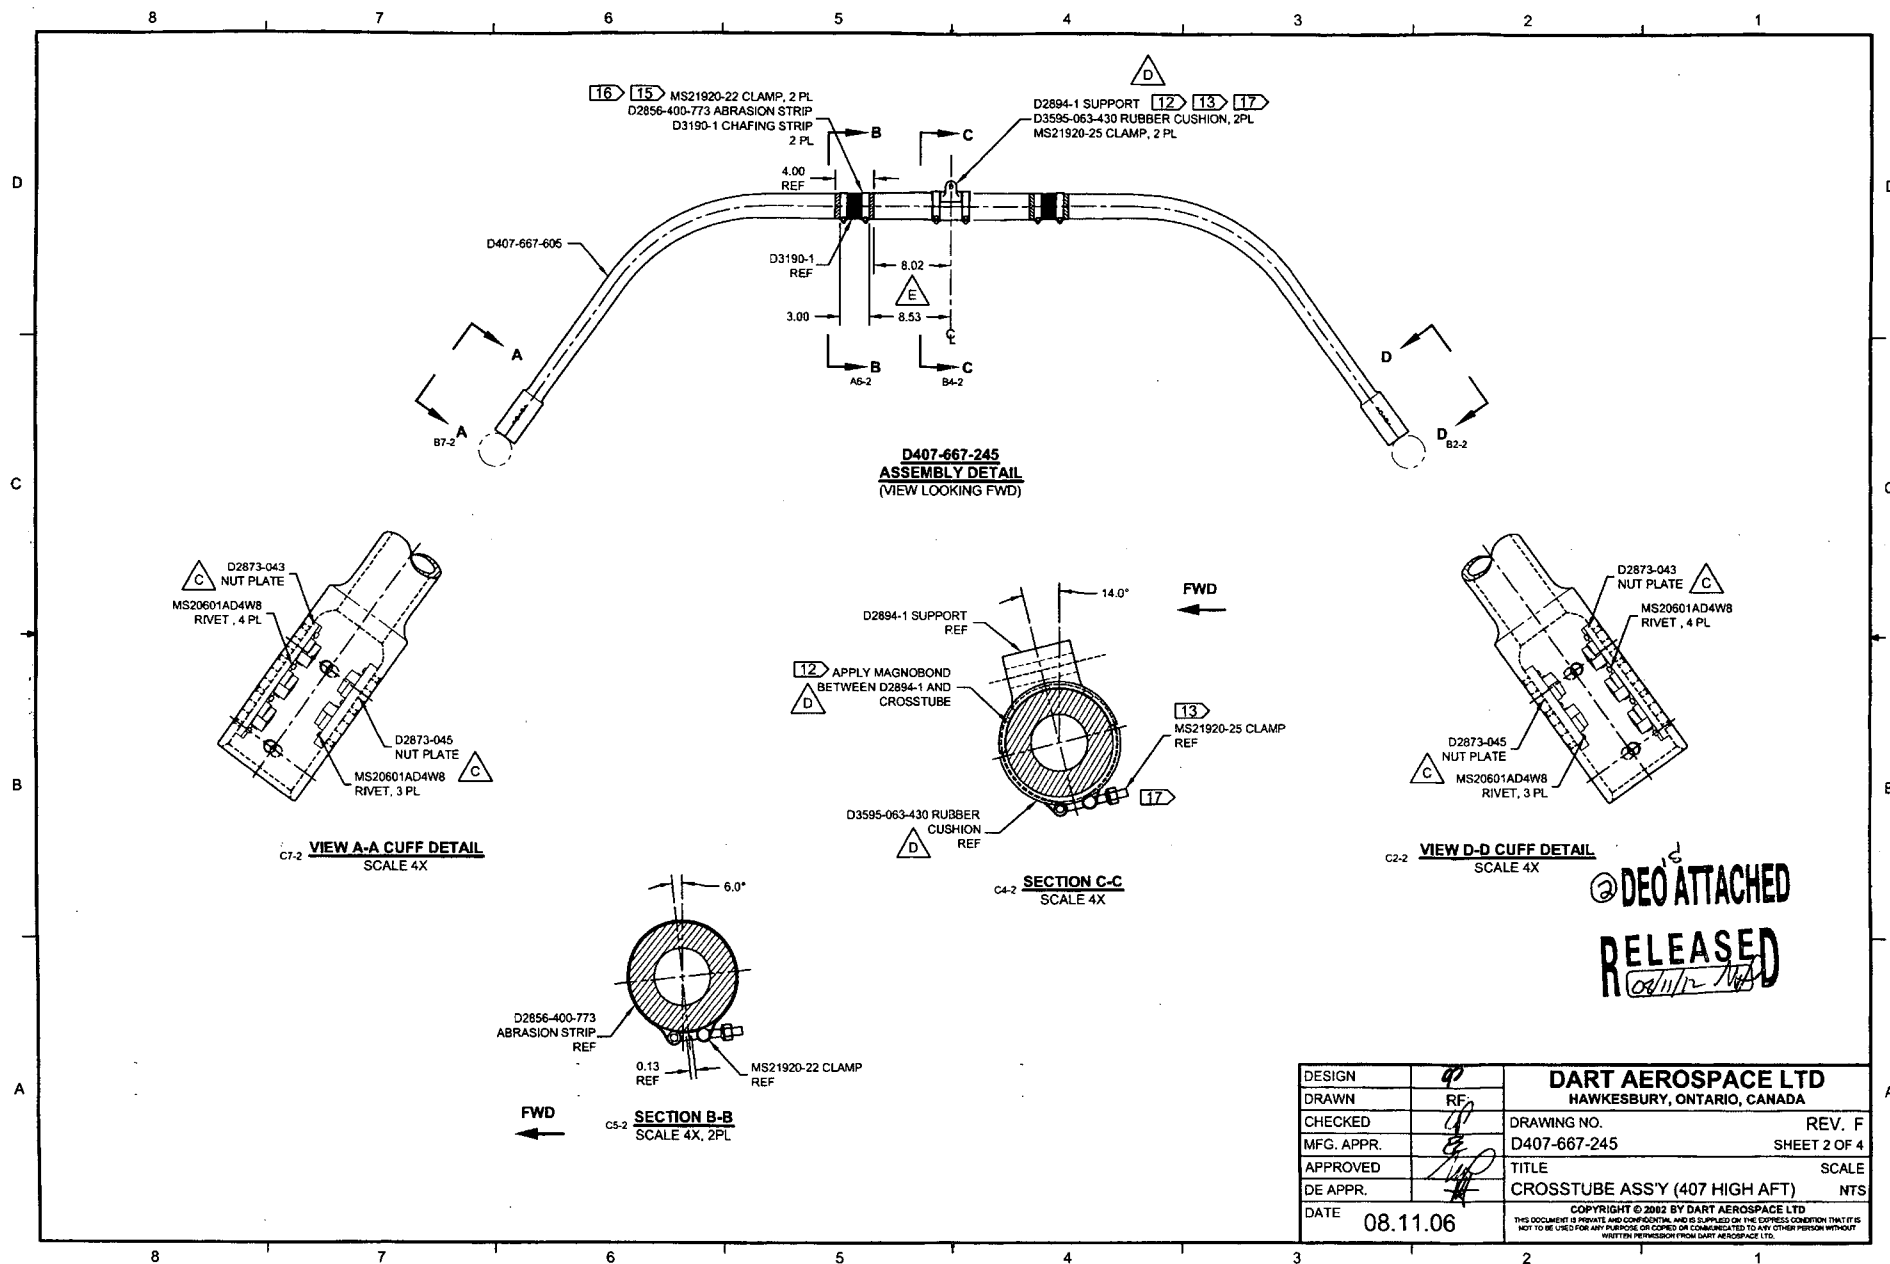

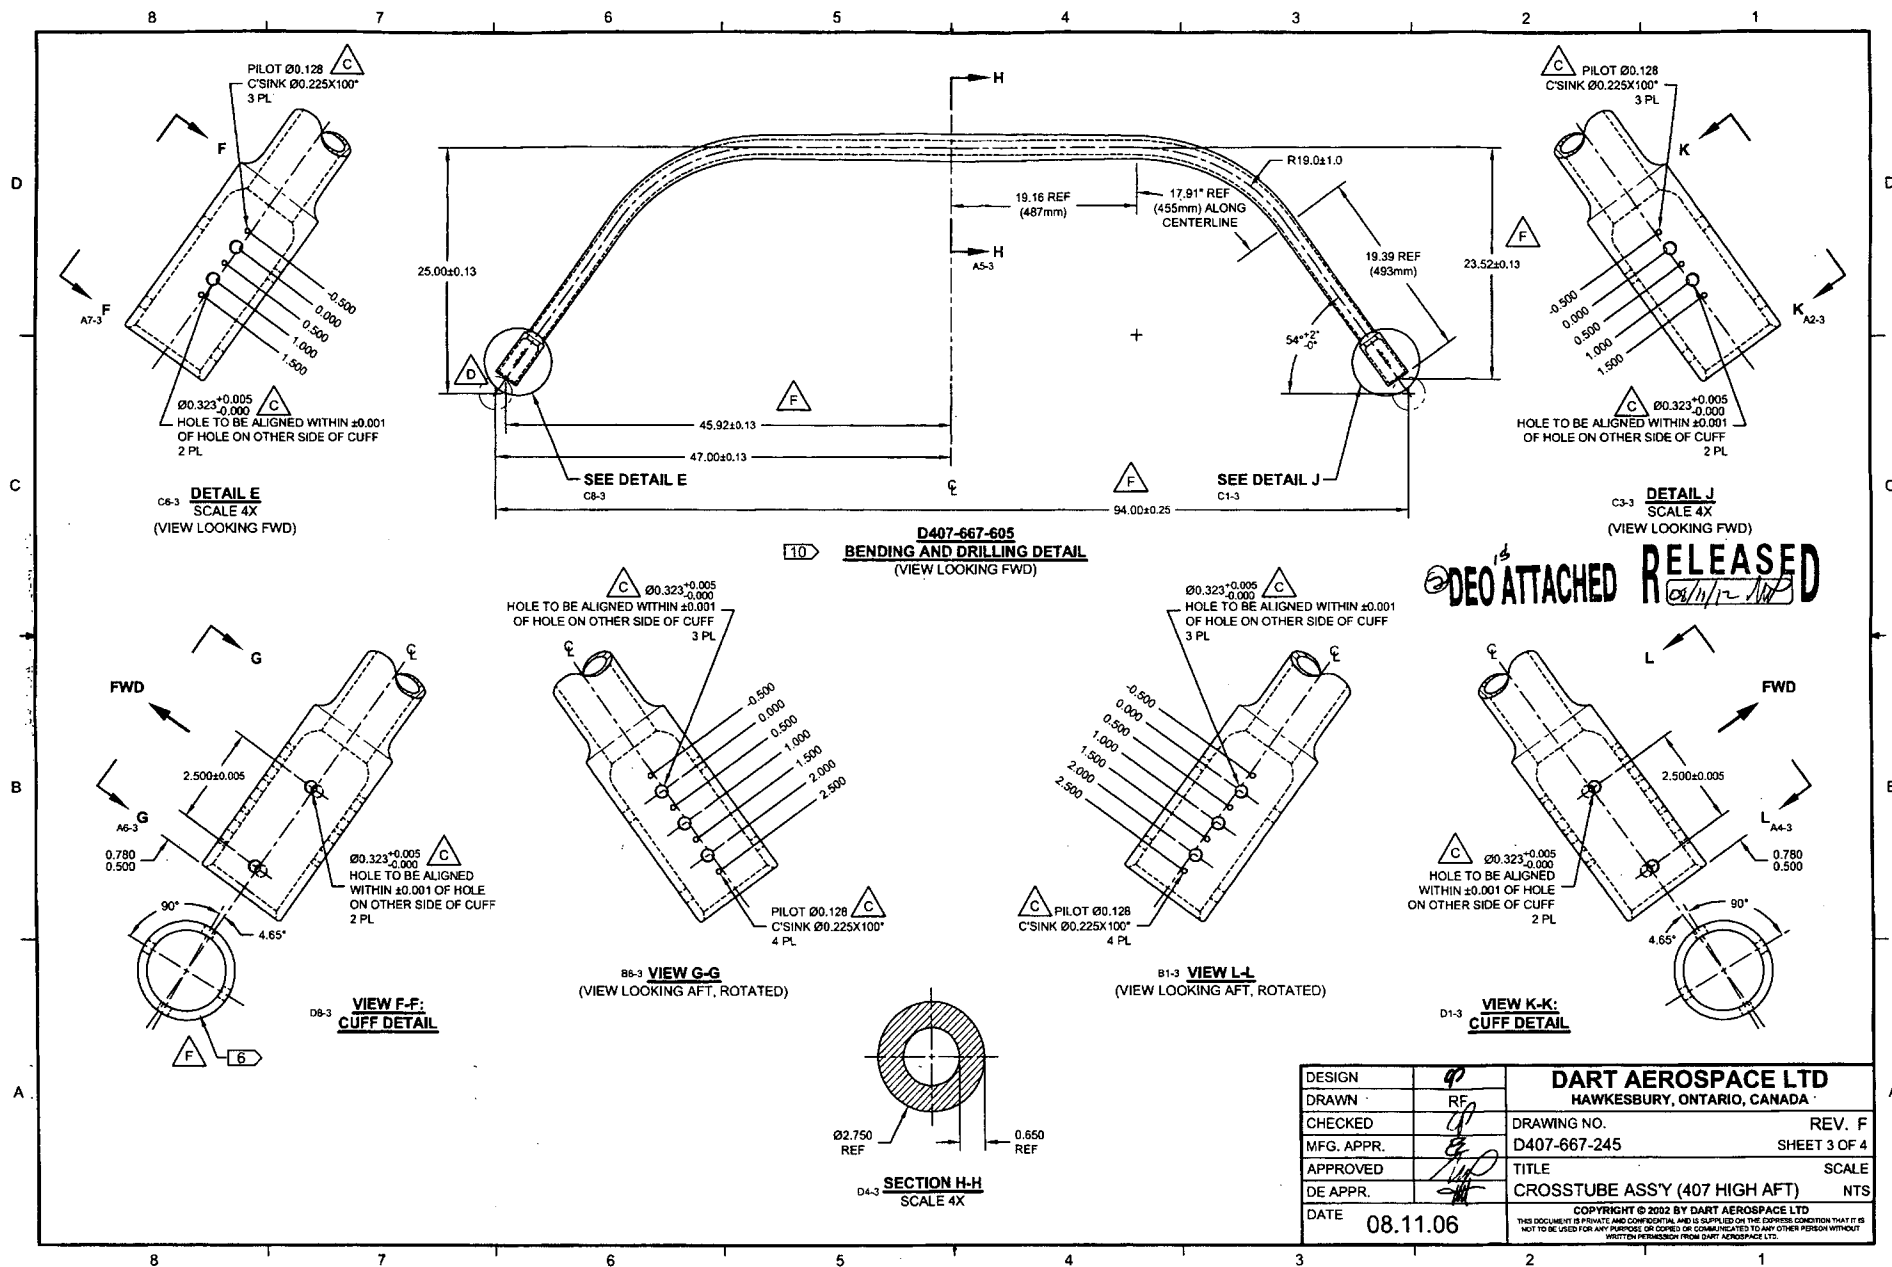

DESIGN	40	<b>DART AEROSPACE LTD</b>	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	40	DRAWING NO.	REV. F
MFG. APPR.	40	D407-667-245	SHEET 3 OF 4
APPROVED	40	TITLE	SCALE
DE APPR.	40	CROSSTUBE ASSY (407 HIGH AFT)	NTS
DATE	08.11.06	<small>COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESSED CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

**D407-667-245 MACHINING DETAIL**

**RELEASED**  
08/11/12

**DEO ATTACHED**

SEE DETAIL M  
A7-4


R100.0 TRANSITION  
BETWEEN TAPERED  
SECTIONS

R100.0 TRANSITION  
BETWEEN TAPERED  
SECTIONS


R100.0 TRANSITION  
BETWEEN TAPERED  
SECTIONS

SEE DETAIL P  
A2-4


TAPER UNIFORMLY FROM  
2.633<sup>+0.005</sup><sub>-0.005</sub> REF THROUGH TO 2.790<sup>+0.005</sup><sub>-0.005</sub> REF  
RUNNING OFF PART

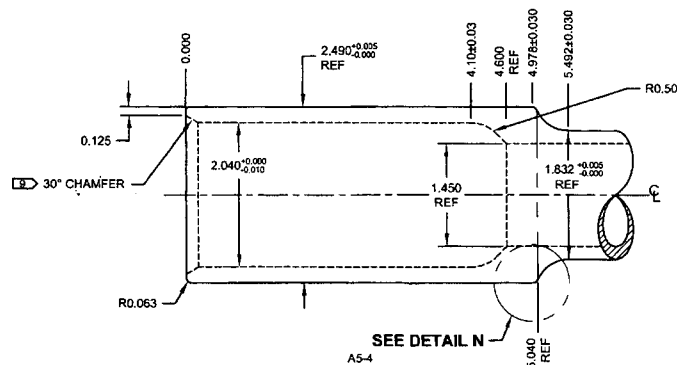

**DETAIL M: CROSSTUBE CUFF**  
SCALE 3X

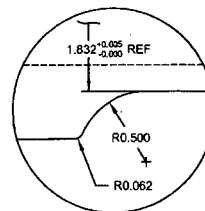

**DETAIL N: CUFF TRANSITION**  
SCALE 2X

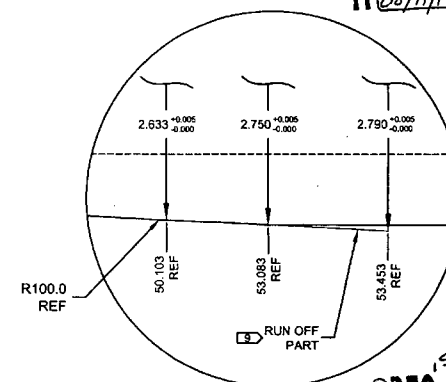

**DETAIL P: TAPER RUN-OFF**  
NOT TO SCALE

DESIGN	40	<b>DART AEROSPACE LTD</b>	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	40	DRAWING NO.	REV. F
MFG. APPR.	40	D407-667-245	SHEET 4 OF 4
APPROVED	40	TITLE	SCALE
DE APPR.	40	CROSSTUBE ASSY (407 HIGH AFT)	NTS
DATE	08.11.06	COPYRIGHT © 2002 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

DRAWING NO. D407-667-245	TITLE CROSSTUBE ASSY (407 HIGH AFT)	REV. F	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D407-667-245-F-1	SHEET NO. SHEET 1 OF 2	SCALE NTS
DRAWN	CHECKED	MFG. APPR.	APPROVED	DE APPR.			
DATE 11.04.08	DATE 11.04.12	DATE 11.04.12	DATE 11.04.12	DATE 11.04.12	DATE 11.04.12		

**PURPOSE:**

REMOVED ABRASION STRIP IN FAVOR OF A THIN LAYER OF PROSEAL 890.

**CHANGE:**

PARTS LIST IS AMENDED AS FOLLOWS:

**IS:**

Item	Qty	Part Number	Description
	-245		
3	0	D2856-400-773	ABRASION STRIP

**WAS:**

3	2	D2856-400-773	ABRASION STRIP
---	---	---------------	----------------

NOTES 2 AND 15, SHEET 1 ARE AMENDED AS FOLLOWS:

**IS:**

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA) AND  
PAINT OUTSIDE PER DART QSI 005 4.2  
REMOVE MASKING AND APPLY CLEAR COAT
- 15) APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3190-1  
CHAFING SHIELDS AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL  
PROSEALED D3190-1 CHAFING SHIELDS ONTO CROSSTUBE BY APPLYING A THIN COAT  
OF PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.

**WAS:**

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- 15) INSTALL D2856-400-773 ABRASION STRIP WITH A 0.13 REF GAP ON BOTTOM SIDE OF  
CROSSTUBE PER QSI 035.


**RELEASED**  
2011-04-18  
*[Signature]*

DRAWING NO. D407-667-245	TITLE CROSSTUBE ASSY (407 HIGH AFT)	REV. F	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D407-667-245-F-1	SHEET NO. SHEET 2 OF 2	SCALE NTS
DRAWN	CHECKED <i>UP</i>	MFG. APPR. <i>E</i>	APPROVED <i>W</i>	DE APPR. <i>H</i>		
DATE 11.04.08	DATE 11.04.11	DATE 11.04.12	DATE 11/04/12	DATE 11.04.12		

**IS:**

**WAS:**

**RELEASED**  
2011-04-18  
*W*

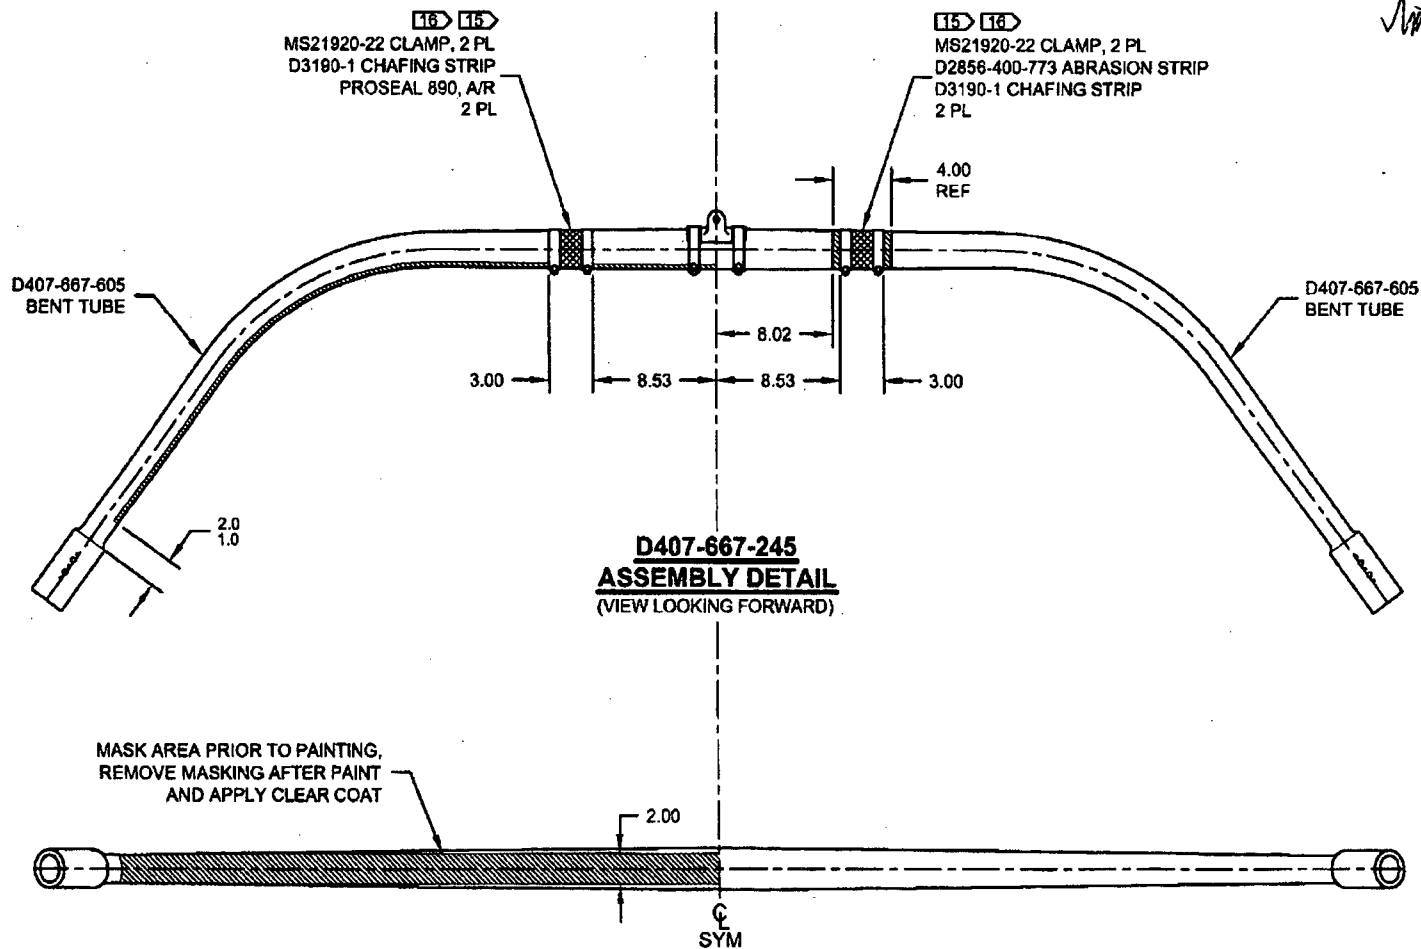

DRAWING NO. D407-667-245	TITLE CROSSTUBE ASS'Y (407 HIGH AFT)	REV. F	<b>DART AEROSPACE LTD ENGINEERING ORDER</b>		D.E.O. NO. D407-667-245-F-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>q</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>E</i>	APPROVED <i>MP</i>		DE APPR. <i>th</i>		
DATE 11.09.07	DATE 11.09.19	DATE 11.09.19	DATE 11.09.19		DATE 11.09.19		

**PURPOSE:**

REPLACE MAGNOBOND WITH 3M DP460 SCOTCH-WELD EPOXY ADHESIVE

**CHANGE:**

IS:

Item	Qty -245	Part Number	Description
12	A/R	SCOTCH-WELD DP460	EPOXY ADHESIVE, 3M SCOTCH-WELD

WAS:

12	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
----	-----	----------------	---

NOTE 12 & 17, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) INSTALL D2894-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015. LET CURE FOR 24 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVE HAS CURED FOR 24 HOURS.

WAS:

- 12) INSTALL D2894-1 CENTER SUPPORT USING A 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

**RELEASED**  
2011-09-29  
*MP*